Item	Part #	Description	Qty.
1	2774064	i-LINK CONTROLLER 3.0 TRV,ULTX	1
1	2774068	i-LINK CONTROLLER 3.0 RT TRV	1
2	2994076	REMOTE ASY, LINK TOUCHSCRN	1
3	2996400	HEADING SENSOR ASSEMBLY	1
4	2390800	LANYARD w/CARABINEER,IP REMOTE	1
■	2397103	MANUAL, QUICK REF IPILOT 1.6	1
5	2224704	INSERT-PLUG,BLK,i-PILOT LINK	1
6	2375901	ADAPTER, USB DC POWER LINK	1
7	2373241	CABLE, USB REMOTE CHARGER LINK	1
8	480389-1	CABLE, ETH (M12-M-M12-F,30'	1
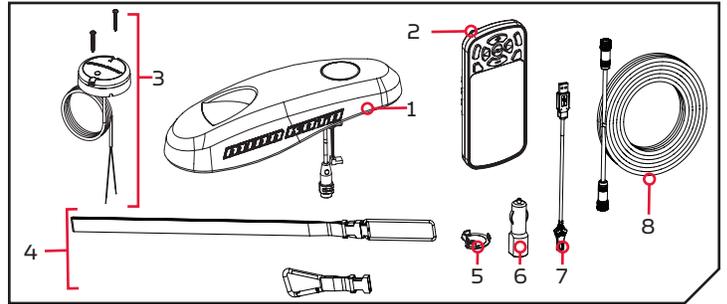
TOOLS AND RESOURCES REQUIRED

- #2 Phillips Screwdriver
- 10-15 minutes
- Terrova BT or Ultrex Motor

⚠ CAUTION

Always wear safety glasses and gloves. Disconnect all power to the trolling motor before beginning any work or maintenance. Johnson Outdoors Inc. is not responsible for any damage due to improper rigging or installation. If you do not have the skills, experience and tools to perform the following maintenance and repairs, we recommend you seek the help of a Minn Kota Authorized Service Center. A list of Authorized Service Centers can be found at http://www.minnkotamotors.com/Authorized-Service-Providers/. Or contact our Technical Service Department by email at service@minnkotamotors.com or, by dialing 800-227-6433.

NOTE: These instructions cover accessory installation only. To download the complete owner's manual visit https://www.minnkotamotors.com/Accessories.aspx. Scan the QR code to view Minn Kota Accessories Owner's Manuals Online

NOTE: User Manuals for i-Pilot Link features on Humminbird Units are available at https://www.humminbird.com/Category/Support/Product-Manuals/?q=link. Scan the QR codes to the right to access manuals for Helix or Solix/Onix Units.

Helix Units   Solix Units

REMOVAL

a. Use the #2 Phillips Screwdriver to remove the 4 screws that secure the control box cover and remove the control box cover

b. If AutoPilot or i-Pilot was installed disconnect the Accessory Plug and set the AutoPilot Board or i-Pilot Controller Aside. The i-Pilot Controller or AutoPilot Board will not be reused.

Pull Straight Apart

c. Remove the Insert Plug. Push forcefully on the edge closest to the coil cord, the plug will "pop" out.

INSTALLATION

a. Route the Ethernet cable that is attached to the i-Pilot Link Controller down through the opening that the Insert Plug was removed from.

b. Continue feeding the Ethernet cable down the interior of the coil cord.

c. Install the Insert plug that was included with this kit. Position the Tab that is opposite the opening in the Insert Plug in the Slot closest to the the Motor Shaft, guide the US2 Cable, if installed, and the Ethernet cable into the opening in the Insert Plug then push up on the Insert Plug until the other two tabs snap into place.

d. Connect the Accessory Plug from the i-Pilot Link Controller to the Network Accessory Plug.

e. Place the i-Pilot Link Controller on the control box, use the #2 Phillips Screwdriver to install the four screws that secure the Controller/Control Box Cover.

Push Straight Together

NOTE: Complete the installation by routing the Ethernet cable as described in your motor's Owner's Manual and connecting the Ethernet cable to your Humminbird Helix or Solix. Use of the included 30' Ethernet Extension Cable is optional. If connecting to a Helix Unit use of an AS EC QDE adapter will be required, the included cables can be connected directly to Solix Units or to the Humminbird 5 Port Ethernet Switch.

For warranty information please visit minnkotamotors.com